COMMONWEALTH OF KENTUCKY BEFORE THE PUBLIC SERVICE COMMISSION

In the Matter of:

۲.

KENTUCKY POWER COMPANY)	
GTE SOUTH INCORPORATED)	CASE NO. 89-258
ALLEGED FAILURE TO COMPLY WITH) COMMISSION REGULATIONS	

ORDER TO SHOW CAUSE

Kentucky Power Company ("Kentucky Power"), which engages in the distribution of electricity to the public, for compensation, for light, heat, power, and other uses, is a utility under the jurisdiction of the Commission.

GTE South Incorporated ("GTE"), which engages in the transmission over wire of messages by telephone for the public, for compensation, is a utility under the jurisdiction of the Commission.

KRS 278.280(2) directs the Commission to prescribe rules and regulations for the performance of services by utilities. Pursuant to this statutory directive, the Commission promulgated Commission Regulation 807 KAR 5:041, Section 3, which requires electric utilities to maintain their plants in accordance with the standards of the National Electrical Safety Code (1981 edition),

and Commission Regulation 807 KAR 5:061, Section 2, which requires telephone utilities to do likewise.

Commission Staff has submitted to the Commission an Electrical Utility Accident Investigation Report dated August 23, 1989, attached hereto as Appendix A, which alleges:

- 1. On July 20, 1989, Johnny Minks was fatally injured in Lost Creek, Kentucky, when he came into contact with a 7200 volt single phase overhead line owned and maintained by Kentucky Power. At the time of the incident, Mr. Minks was attempting to install a CB antenna on the roof of a building.
- 2. At the time of the incident, the electric utility lines hanging over the building, the 7200 volt single phase, a neutral conductor, and a lash secondary line, all owned and maintained by Kentucky Power, failed to comply with the minimum vertical clearance standards for above-ground wires and conductors as established by National Electrical Safety Code Rule 234C2. The communications conductor, which hung over the building and was owned and maintained by GTE, also failed to comply with these standards.
- 3. Kentucky Power violated Commission Regulation 807 KAR 5:041, Section 3, by failing to comply with the standards of the National Electrical Safety Code.
- 4. GTE violated Commission Regulation 807 KAR 5:061, Section 2, by failing to comply with the standards of the National Electrical Safety Code.

WHEREFORE, the Commission, on its own motion, HEREBY ORDERS that:

- 1. Kentucky Power and GTE shall each submit to the Commission a written response to the allegations contained in the Electrical Utility Accident Investigation Report within 20 days of the date of this Order.
- 2. Kentucky Power and GTE shall appear on November 15, 1989 at 1:00 p.m., Eastern Standard Time, in Hearing Room No. 1 of the Commission's offices at 730 Schenkel Lane, Frankfort, Kentucky, for the purposes of presenting evidence concerning the incident which is the subject of the Electrical Utility Accident Investigation Report, specifically the alleged violations of Commission Regulations 807 KAR 5:041, Section 3, and 807 KAR 5:061, Section 2, and of showing cause, if any they can, why they should not be subjected to the penalties of KRS 278.990 for their alleged failure to comply with Commission Regulations.
- 3. The Electrical Utility Accident Investigation Report dated August 23, 1989 is hereby made a part of the record of this case.

Done at Frankfort, Kentucky, this 19th day of September, 1989.

Chairman

Vice Chairman

ATTEST:

Executive Director

APPENDIX A APPENDIX TO AN ORDER OF THE KENTUCKY PUBLIC SERVICE COMMISSION IN CASE NO. 89-258 DATED 9/19/89

ELECTRICAL UTILITY ACCIDENT INVESTIGATION

DATE OF THIS REPO	RT <u>8/23/89</u>	_ SUBMITTED BY	John W. 1	Land
NAME OF UTILITY _	Kentucky Power (Haza	ard Division)		
ACCIDENT REPORTED BY Wayne Edwards-Safety and Health Manager				
DATE & TIME UTILI	TY LEARNED OF ACCIDE	DAT <u>7/20/89</u>	:05 P.M.	
DATE & TIME ACCID	ENT REPORTED 7/20/	898:50 P.M.		
DATE AND TIME ACC	IDENT OCCURRED 7/20	0/89-4:50 P.M.		
DATE OF ACCIDENT	INVESTIGATION 7/21	/89		
DATE SUMMARY WRIT	TEN REPORT WAS RECE	IVED FROM UTIL:	TY <u>7/26/</u>	89
PERSONS ASSISTING	IN THE INVESTIGATION	ON P.R. Willia	amson Huma	n Resources
Supervisor-R.J.	Eversole Engineer S	upervisor-Glen	Combs Dra	ftsman-
Paul Pratt Servi	ceman-Steve Campbel	l Serviceman,	all person	nel of
Kentucky Power.	· · · · · · · · · · · · · · · · · · ·	-		
NAME OF VICTIM(S)	1. John Minks			_ AGE
PATAL No	NAME OF EMPLOYER:	Self Employ	ed	
INJURIES Sec	ond degree burns to	face; third d	egree burn	s to legs.
	2.	<u> </u>	SEX	MGE
PATAL	NAME OF EMPLOYER:			
	·			
	3.		SEX	MGE
PATAL	NAME OF EMPLOYER:			

ELECTRICAL UTILITY ACCIDENT INVESTIGATION (Continued)

LOCATION OF ACCIDENT SITE Mr. Ed. Gregory Heavy Equipment Repair Garage off Hwy. 15 West of Hazard near Lost Creek, Kentucky. DESCRIPTION OF ACCIDENT Mr. Johnny Minks and Mr. Tom Mullins were alleged to have been attempting to install a CB Antenna on a building belonging to Mr. Ed Clemons and leased by Mr. Ed Gregory. Mr. Johnny Minks apparently made accidental contact with a 7,200 volt overhead line, while attempting to install top section of CB Antenna on bottom section which had already been installed on end of this building. SOURCE OF INFORMATION Mr. P.R. Williamson, Mr. R.J. Eversole, Mr. Glen Combs, Mr. Paul Pratt, Mr. Steve Campbell employees of Kentucky Power's Hazard Division. There was also an onsite investigation made by myself John W. Land of the Public Service Commission's Engineering staff, plus utility, coroner and EMT accident reports. I also tried to interview Mr. Tim Mullins but was unable to do so. Hospital was unable to obtain any information on Mr. Minks. VIOLATIONS OF COMMISSION REGULATIONS There is a low clearance of primary conductor to structure, secondary 1/0 lash conductor to structure and telephone conductor to structure at this location. Mr. Ed Gregory's Garage, Hwy. 15, Lost Creek, Kentucky. Kentucky Power's single phase and lash secondary lines are in violation of 807 KAR 5:041, Section 3(1) 1981 NESC Edition Table 234-1 (Vertical). (See line clearances of this report) General Telephone's phone cable is in violation of KAR 5:061, Section 2(1) 1981 Edition Table 234-1 (Vertical) (See Line Clearances of this report.)

RECOMMENDATIONS It is recommended that Kentucky Power and General
Telephone Company take corrective action to correct these clearances
and furnish documentation as to corrective action taken. It is also
recommended that the Commission consider action in accordance with
KRS 278.990 due to line clearance violations by Kentucky Power and
General Telephone required by 807 KAR 5:041, Section 3(1) and 807
KAR 5:061, Section 2(1); NESC Table 234-1 (Vertical).
CORRECTIVE ACTION Corrective action has been taken to correct this
low clearance and documentation will be furnished by this utility
upon receipt of this report.

LINE CLEARANCES

		As Measured	Minimum Allowed by NESC 1981 Edition
A.	AT POINT OF ACCIDENT		
	Phase conductor to ground elevation:	31'-2"	20'-0"
	Neutral conductor to ground elevation:	25'-5"	18'-0"
	Lash Secondaries to ground:	25'-5"	18'-0"
	Communication conductor to ground elevation:	23'-1"	18'-0"
	Phase conductor to structure:	5'-5 1/2	10'-0"
	Neutral conductor to structure:	0'-0"	3'-0"
	Lash Secondaries to structure:	0'-0"	3'-0"
	Communication conductor to structure:	0'-0"	3'-0"
в.	AT LOWEST POINT OF SPAN		
	Phase conductor to ground elevation:	31'-2"	20'-0"
	Neutral conductor to ground elevation:	25'-5"	18'-0"
	Communication conductor to ground elevation:	23'-1"	18'-0"
c.	SPAN LENGTH 247'		
Dat	e the line or facilities were con	nstructed: Dece	nber, 1985
Oti	lity: Kentucky Power - Hazard I	Division	
Date: 7/21/89 Time 12:00 P.M.			
Approximate temperature: 88 Degrees F			
Measurements made by: R.J. Eversole Engineer-Paul Pratt Serviceman			
of Kentucky Power - Hazard Division and witnessed by John W. Land			
of	the Commission Engineering staff	E	
	Submitted by:		
	Page (4 of 4	V

ACCIDENT AND TROUBLE REPORT FORM

TODAY'S DATE 7/10/29	TIME 8:50 PM
COMPANY Ky POWEY - 1422	and Division
PERSON REPORTING INCIDENT: NAME:	
	SAGETY AND HEAlth Mar.
	Ashland, Xy
Phone no:_	606-327-1271
ACCIDENT DESCRIPTION: CB ANT	ENNA Contact 7200 Volt Single
Phase Overhead line	*.
VICTIMS NAMES: John Minke	Sex M age Death Injury W
	sex age deathinjury
	•
-10	SEX AGE DEATHINJURY
LOCATION OF ACCIDENT: Ed. Gree	gry. HEAVY Equipment
KEPAIN GAVAGE LOST CREEK, KY	m Huy 15- West of HAZAVO
TIME OF OCCURRENCE: CAN FAKEL	4+5:05 P.M. 1/20/89
TROUBLE DESCRIPTION: Single ?	hasa TAD out
TIME OF OCCURRENCE: 4.50 P.M.	1.
TIME OF RESUMPTION OF NORMAL SERV	
NUMBER OF CUSTOMERS AFFECTED:	Wo Each
	SIGNED Kathanil
	DATE

1701 Central Avenue P. O. Box 1428 Ashland, KY 41105-1428 606-327-1111



RECEIVED

Claude G. Rhorer, Jr., Director Division of Engineering and Services Public Service Commission 730 Schenkel Lane PO Box 615 Frankfort, KY 40602 DIVISION OF UTILITY

July 24, 1989

Dear Mr. Rhorer:

Attached is the Summary Written Report for a public contact accident which occurred in Kentucky Power Company's Hazard Division. This accident happened July 20, 1989 and resulted in non-fatal burns to Mr. Johnny Minks of Viper, Kentucky.

Supplemental information as requested by Mr. John Land will be provided as quickly as it becomes available. Any questions should be directed to me at 606/327-1271.

Sincerely,

Salety and Health Manager

c Attachment

DESTRUCKY FORMS


PRINCIPALIC ACCIDENT MOTICS


FRINKS? WITCH?


(1)	Johnny Kinks	100
فيستق	Address	Thomas
s justed		Ness
17005	Rt. 43D, Viper, Restucky 41774	606-439-4036
	Cocupation Implayed by	
(2)	Sales a Installation of Redio Sections Self	bivisian
<u>6 21000</u>	2-20-40 S.00 MI W. S Bent, 15 and Lost Creek, Eu.	Sauard
(3)	Deto & Time of Loss or Angians, Losseian 7-20-69 5:00 Mt TE of Rect, 15 and Lost Creek, Eu.	
	2nd degree famial horne; 3rd degree leg burgs	
(z)my		
	There was injured token after escident	e of Poctor
	Hiddle Ig. Liver Bospital, Jackson, Kentucky	
(4)	Over	these:
perty nes	Adiress	
	List Benege	lotimated cost
(5)	Mone Committee	Thome :
	Tim Bullins	
1001006	Accup Creek	
		Thomas
rtant to	Adicoss	Two.
fell		
. 6	Name	There's
To sea		
7	Address	-
(6)	Obtain the names and addresses of disinterested vituases the	and such (see short
(4)	the occurrence including date, hedge No. or name of police anti	perity to them the
	sections was reported.	·
•	Mr. Minks and Mr. Mullins were installing a CW antenna on top	of a building.
riptica	During the installation process, part of the enterns made con	
ol ideat		
	energized 7200 volt lime.	
	It is important that any article, part or syplicates occoing the	opentrace be
	It is important that may article, part or sypliance ecoolog the exceptilly preserved. Attack should if appropriate.	openspace to
	It is important that any article, part or applicant opening the exceptilly preserved. Attack should if appropriate. Bute 7-24-89	


PSC Field Sketch

41

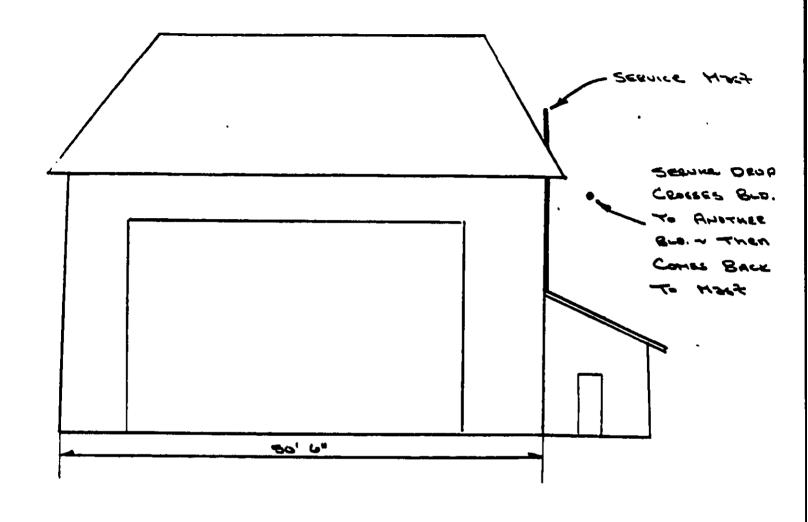

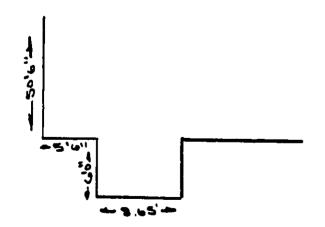

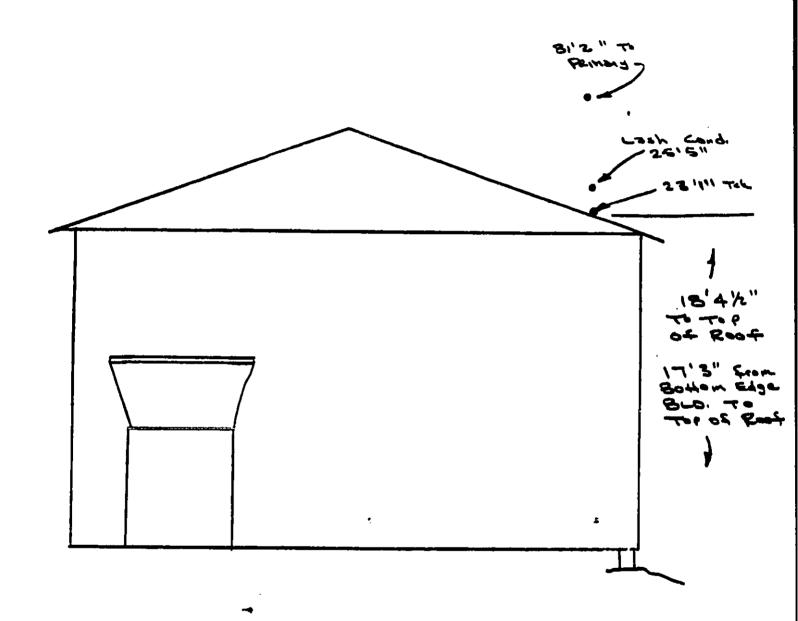

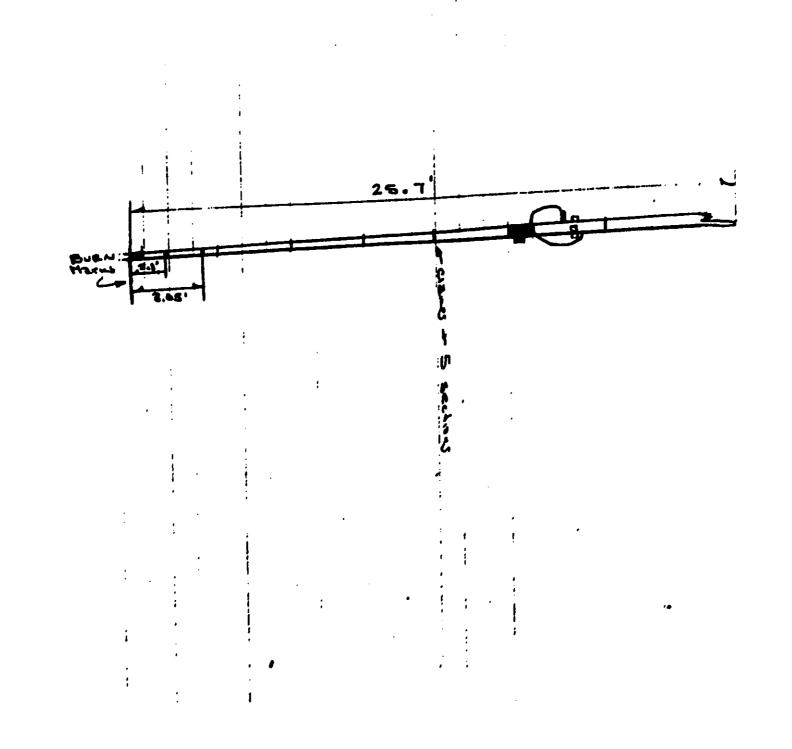

3

*

Kentucky Power Company 608 High Street P 0 80x 958 Hazard, KY 41701-0958 606-436-1212



RECEIVED

AUG 08 1989

DIVISION OF UTILITY ENGINEERING & SERVICES

Public Service Commission 730 Schenkel Lane Box 615 Frankfort, Kentucky 40602

August 7, 1989

Attn: John Land

Subject: Johnny Minks 7-20-89

Dear John:

Per your request, the system inspection was performed on the accident site on March 27, 1989.

The inspection is completed by using a distribution map and checking off each pole and the equipment on it. When the technician completes the inspection, any system deficiencies are posted to our inspection inventory sheet. Jobs would then be issued to correct any problem. The inventory inspection sheet is maintained chronologically.

Attached is the inspection inventory sheet for the March 27, 1989 period. You will note that no work was released at that time.

Additionally, you requested the EMT report. Mr. Ron Montgomery with Crawford and Company is in the process of obtaining this report.

Feel free to contact me if you require additional information.

Very truly yours,

P. R. Williamson

Human Resources Supervisor

PRM: CF

Attachment

CC: Wayne B. Edwards W/A

INSPECTION - INVENTORY

		4	JOB		·	
DATE	W. O. NUMBER	DESCRIPTION 464-28	PLANNER	d a T OT	Action HOURS-TENAN	COMPLETIC
2-10-89	290410011	BEPLACE BAD POLE	E.M.	2-23-89	Refress	3-25-5
2-10-89	810410010	REPLACE Guy, 487-81	6M.	2-23-89	Cancellod	-
-10-89	050 - 2(05 890410007	559-6 559-14 REMALE BAD POLES	EM.	2-23-89	Rapional	
-2-89	890610009	Remove service	280	3-2-89	Benoved Service	3-14-6
-2-89	990-3560 99060 0002	347916 when 90666 2260-19 4 21	ww	3-8-89	34m.	4-10 %
~2-89	89000000	Femore x 5mm	ww	3-8-89	Remove	A-10-4
-Z- & 9	650-7(58 890600004	Rangue x fun 4 TAP	سيس	3-8-89	gamo red	4-10 6
-2-87	67060000000000000000000000000000000000	Genove 4 from.	<u>~~~</u>	3-8-89	K trus	3-16-81
-7-89	390-2179 394450012	Remove 700	ىي س	3-13-89	Grading a rive	
-7~ 6 9	890650014	251-67	لى سا	3 - 13 - 89	British Con	3.22. 5
-3-89	891230019	Replace - 32	EM.			
-3-89	89 123 0018	Pepusce	EM			
-3-89	89 123 00 17	Retire 300 + 600	EM			
-3-89	89 1230021	Replace Bab Pole 437-	en		ļ	
-3-89	2500 121 60	12 317 31, 32	Je.			 -
-3-89	89 121 0034	Remove Lune + 17- 40,24,23	7.6.			İ
-17-89	050- 2315	Rameya - 28 mm.	J.R.			
-17-89	050-2374	483-99 & 147.	<u>۱, ۴.</u>			-
-6-89	890950029 656-2379	Comore pour 104 15 15984,	75			<u> </u>
					<u> </u>	
			<u> </u>	-		
		4				
	ļ				†	
				<u></u>		

Kentucky Power Company 608 High Street P. O. Box 958 Hezard, KY 41701-0958 606-436-1212

RECEIVED

TE THE REAL

AUG 0 1 1989

DIVISION OF UTILITY ENGINEERING & SERVICES

Mr. John Land Public Service Commission 730 Schenkel Lane P. O. Box 615 Prankfort, Kentucky 40602

Re: Johnny Minks Accident 7-20-89

July 31, 1989

Dear Mr. Land:

Per your request, I have enclosed copies of the drawings of the building Mr. Minks was working on, the antenna he was installing, distribution map 102 with the system inspection date of March 27, 1989 in the upper lefthand corner and right-of-way map 102.

Mr. Ron Montgomery, with Crawford and Company, has been requested to obtain a copy of the EMT report. In addition, Mr. Montgomery is attempting to find out the details of when the building was erected. This information will be provided as soon as it is obtained.

If you have additional questions, feel free to call on me.


Yours very truly,

P. R. Williamson


Human Resources Supervisor

Enclosures

cc: W. B. Edwards - w/o enclosures

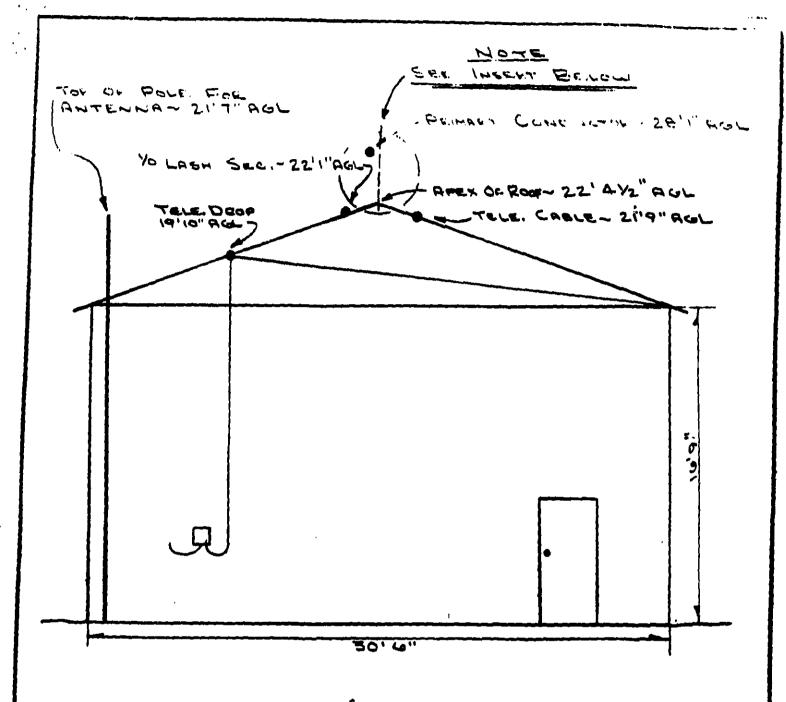

MOTE: AGLE AGOVE GROUND LEVEL

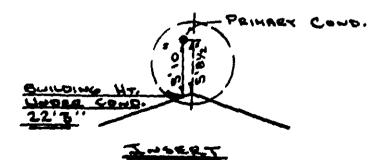

JOHHHY		MINKS		
	ACCIDENT	ON 7-20-89		
	160,	٧.٧.		
	LENGTH	M.O. OR L.O.		
	R-W PUBLIS	W.O. NO.		
	AW PRIVATE	LINE NO.		
	8, 9, W,	DISTRICT		
	BRAWN BY CO. C.	TYPE LINE		
	SCHE NOWS	TAX 0107.		
	DATE TO LACE			

KENTUCKY POWER COMPANY ENGINEEZHING SEPARTIMENT

MENTUCKY

HAZARD

BURVEYED BY BUNGE LA CO.C.

SERVICE MAST

SERVICE

SERVICE

SERVICE

SERVICE

SERVICE

ROAD.


ROAD.

#

SERVICE DROP TO THIS BUILDING COMES BACK FROM THE SERVICE SHOWN ABOUE.

KENTUCKY POWER COMPANY ANGINEERING DEPARTMENT MAZARD MENTUCKY		
JOHHHY ACC: BE HT NEO,	MINKS 00 7-20-89	
LENGTH	M. G. OR L. G.	
AN PUBLIC	W.O. NO.	
RW PRIVATE	LINE NO.	
A.O.W.	BISTRIST	
BRAWN BY CB. C.	TYPE LINE	
BUT MONE	TAK BOOT.	
BATE 3-24-57	MAP MO.	


SURVEYED BY F.W. Q. L.C. G.L.

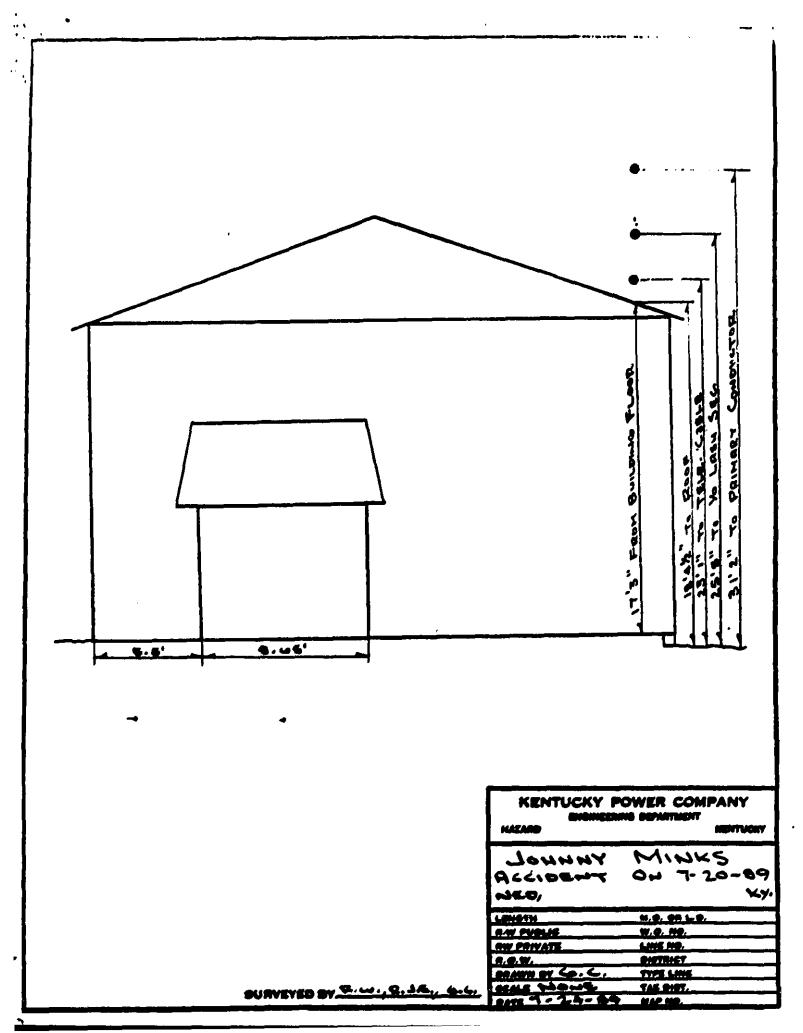

مرد مرد مرد


KENTUCKY POWER COMPANY ENGINEERING DEPARTMENT HAZARD KENTUCKY		
JOHUNY ACCIDENT NED	MINKS ON 7-20-89 KY	
LENGTH	M. Q. OR L. Q.	
RW PRIVATE	LINE NO.	
BRAWN BY CO . C .	TYPE LINE	
PART HONE	TAE DIST.	


SURVEYED BY Q.W. QUE, G.L.

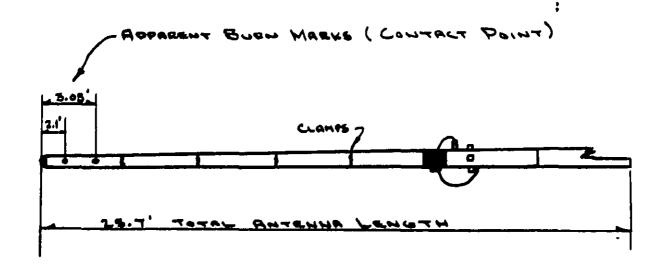


KENTUCKY POWER COMPANY SHOMEZHING GEPARTMENT KENTUCKY		
YHHHOL	MINKS	
RCCIDENT	ON 7-20-69	
NED,	KY.	
LENGTH	M.C. OR L.O.	
RAY PUBLIC	W.O. NO.	
RW PRIVATE	LINE NO.	
R. O. W.	PIETRICT	
GRAWN BY CA. C.	TYPE LINE	
PERE MONE	TAE BIST.	
PATE 7-24-59	MAP NO.	

SURVEYED BY G.W., G. 15. Jac.

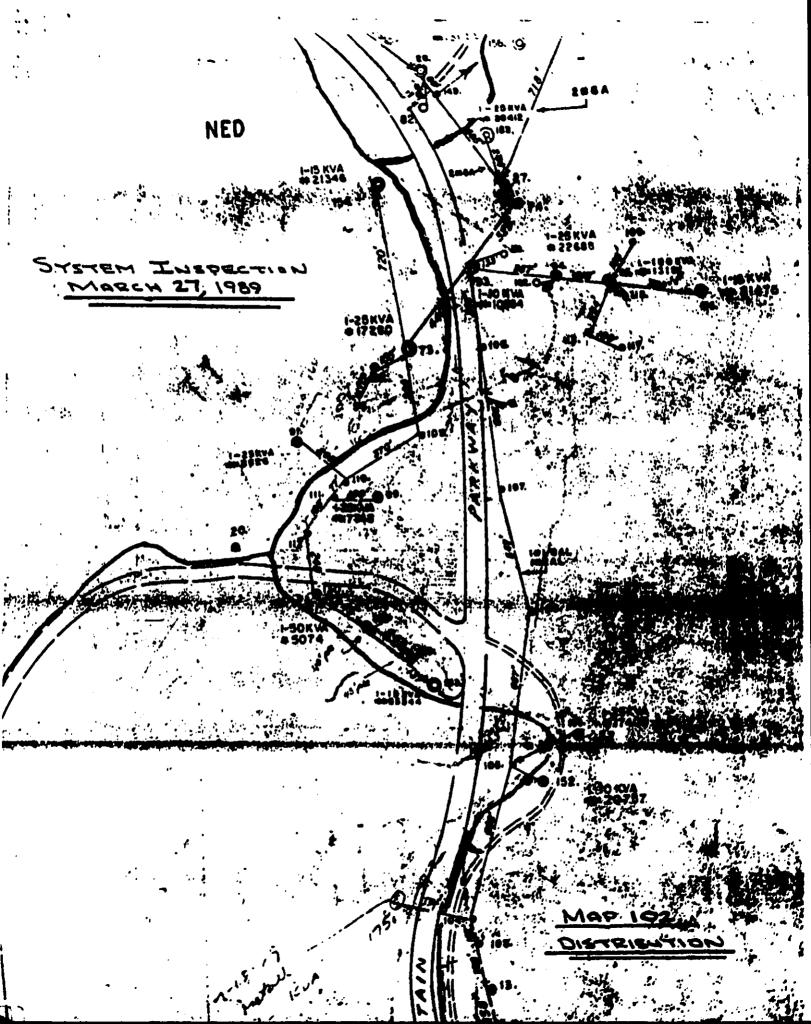

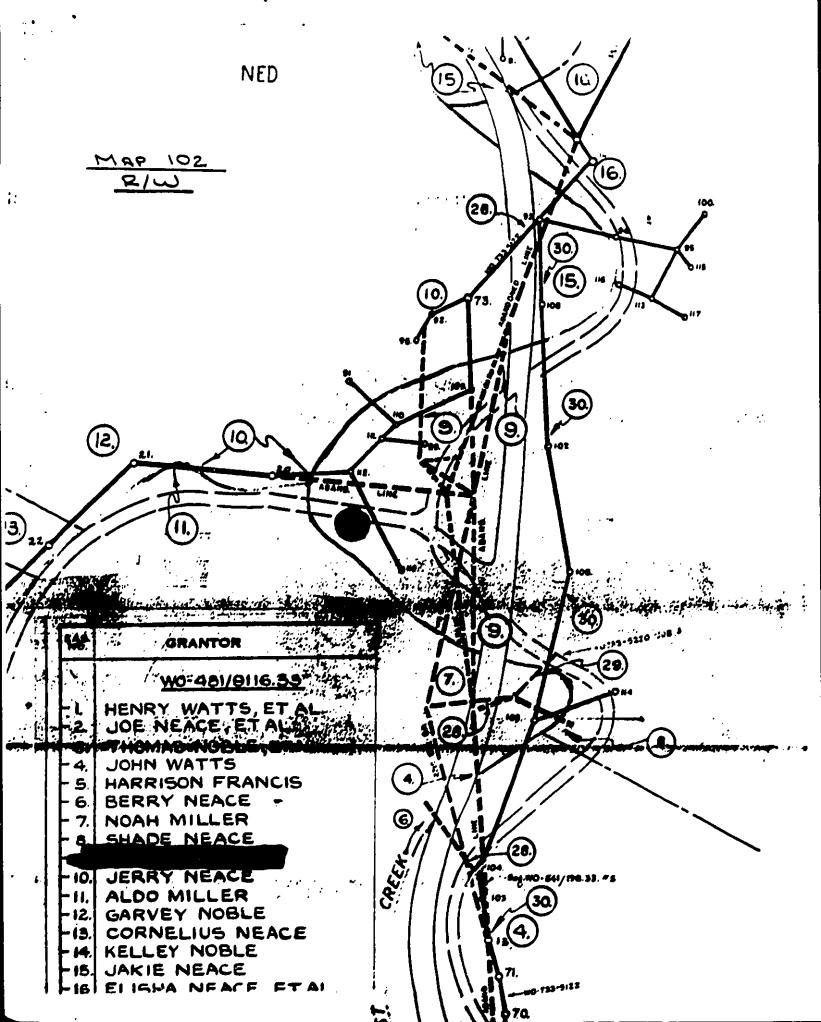


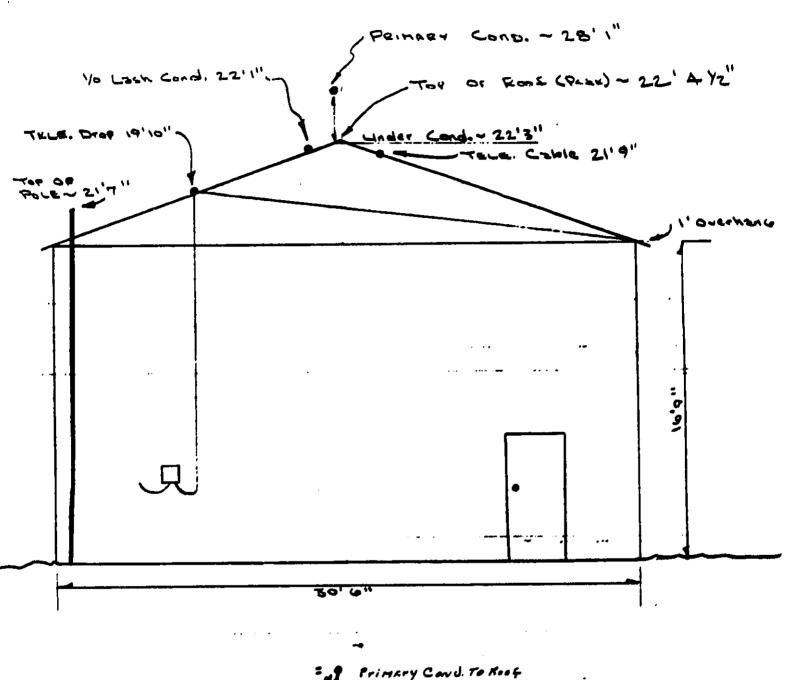


Primary Cand. To Koof


PSC Field Sketch

-

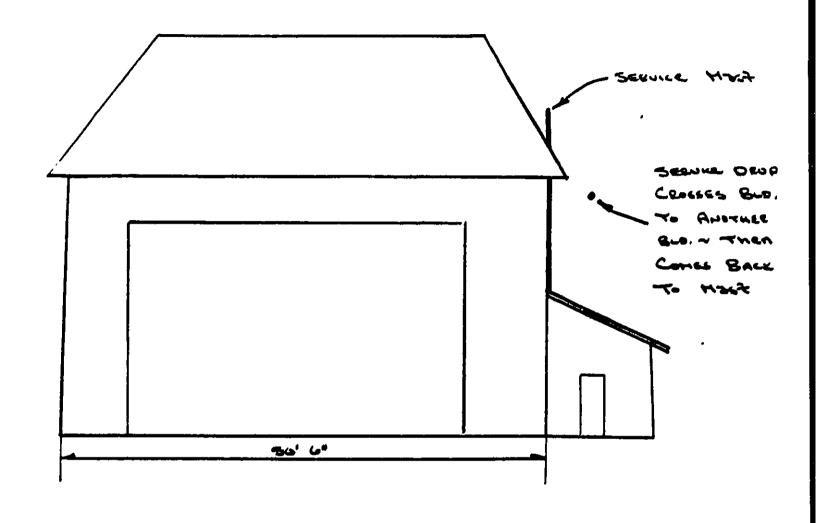

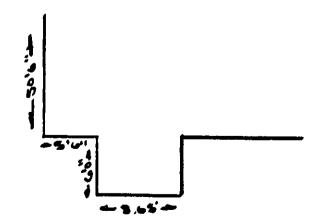

B1'2" TO PRIMENS > Lash Cond. 25'5" 28 1111 Tel 18'4%" TO TOP OF ROOF 17'3" from Bothom Edge Bub. To Top of Roof

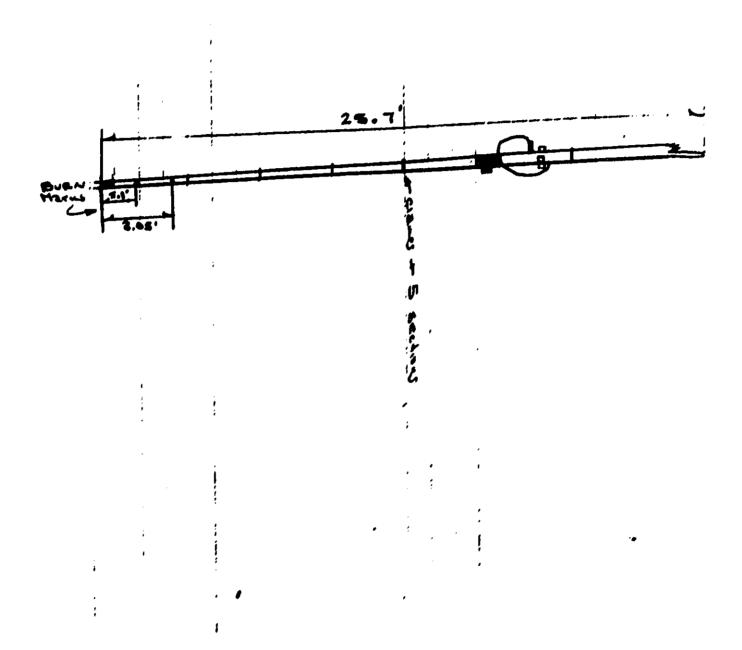

*